

IDM UID **2Z89Z8**

VERSION CREATED ON / VERSION / STATUS

21 Aug 2023 / 1.7 / Approved

EXTERNAL REFERENCE / VERSION

Technical Specifications (In-Cash Procurement)

Technical Specification for Procurement of Optical Fiber Feedthroughs

Technical Specification covers requirements for design, qualification and serial production of PBS 17.OI Optical Fiber Feedthroughs. This Technical Specification forms the part of the Procurement Package, supplementary technical requirements are provided in:

- Appendix A Components Drawings (2SX3KV)
- Appendix B Welding Specification (2VEGGR)
- Appendix C Brazing Specification (2Z82VZ)
- Appendix D Optical Fiber Feedthroughs Identification (2Z86YG)

Table of Contents

1	PURI	POSE	3
2	BACI	KGROUND	3
3	DEFI	NITIONS	4
		FINITIONS OF TERMS USED IN THIS TECHNICAL SPECIFICATION	
		FINITIONS SPECIFIED IN RCC-MR 2007	
4	SCOI	PE	6
	4.1 Sco	DPE OF WORK	6
		OPE OF SUPPLY	
5	STRI	ICTURE OF THE TECHNICAL SPECIFICATION	8
6		CAL FIBER FEEDTHROUGH DESIGN DESCRIPTION	
Ů		Γ OF PARTS	
		ERATING CONDITIONS	
		IENSIONS	
		ERFACES	
7	CLAS	SSIFICATION REQUIREMENTS	12
	7.1.1	Safety classification	
	7.1.2	Quality Assurance Classification	
	7.1.3	Vacuum Quality Classification	
	7.1.4	Seismic Classification	
	7.1.5	Tritium Classification	14
	7.1.6	RCC-MR Classification	14
8	COD	ES AND STANDARDS	14
9	MAN	UFACTURING DESIGN DEVELOPMENT	15
		SIGN VERIFICATION	
	9.2 MA	NUFACTURING DESIGN REQUIREMENTS	16
	9.2.1	Optical fibers requirements	
	9.2.2	Materials requirements	
	9.2.3	Vacuum design requirements	17
	9.2.4	Optical cables tubes design	18
	9.2.5	SVS connection flanges design	19
	9.2.6	Air-side connectors design	
	9.2.7	Weld Design	
	9.2.8	Maintenance and Inspection Plan	
	9.2.9	CAD Requirements	22
10	0 OUA	LIFICATION	22

ITER_D_2Z89Z8 v1.7

10.1 QUALIFICATION OF BRAZING PROCEDURE	22
10.2 QUALIFICATION OF WELDING PROCEDURE	23
10.3 Environmental Qualification	23
10.3.1 Manufacturing of the full-scale prototype	23
10.3.2 Qualification tests of the full-scale prototype	24
11 MANUFACTURING READINESS REVIEW	26
12 MANUFACTURING REQUIREMENTS	27
12.1 FABRICATION PROCESSES	27
12.1.1 Cleanliness and vacuum quality requirements	27
12.1.2 Surface finish requirements	28
12.1.3 Machining requirements	29
12.1.4 Marking	29
12.2 WELDING AND NON-DESTRUCTIVE TESTING	
12.3 METROLOGY AND TOLERANCES	30
13 FACTORY ACCEPTANCE TEST	30
14 SAFETY REQUIREMENTS	31
14.1 GENERAL SAFETY REQUIREMENTS	31
14.2 Protection Important Activities (PIAs)	32
14.3 Propagation of the Defined Requirements	33
14.4 REQUIREMENTS FOR THE COMPETENCES AND QUALIFICATIONS OF THE PERS	ONNEL34
15 DELIVERY	35
15.1 Handling	35
15.2 PACKING	35
15.3 LABELLING OF PACKING CASE	36
15.4 Delivery Readiness Review	37
15.5 SHIPMENT	37
16 FINAL ACCEPTANCE	37
17 DELIVERABLES AND DUE DATES	37
18 CONTRACT FOLLOW-UP	40
18.1 Control Points	40
18.2 HOLD POINTS	40
18.3 Work monitoring	41
18.3.1 Data management	41
18.3.2 Monitoring and Access Rights	41
18.3.3 Periodic meetings	41
18.3.4 Reviews	41
19 QUALITY ASSURANCE REQUIREMENTS	42
20 IO APPLICABLE AND REFERENCED DOCUMENTS	42
20.1 REFERENCED DOCUMENTS	43

1 Purpose

This Technical Specification and its Appendixes define the technical requirements related to the supply of the ITER Optical Fiber Feedthroughs (OFF) to ensure that the supplied components are compliant with the project, quality and nuclear safety requirements.

This technical specification addresses the OFF forming part of the first confinement boundary. They are located on the Upper and Lower Port Extensions of the Vacuum Vessel. Regardless their location, they are provided with the same structure and functionality described on the Figure 1.

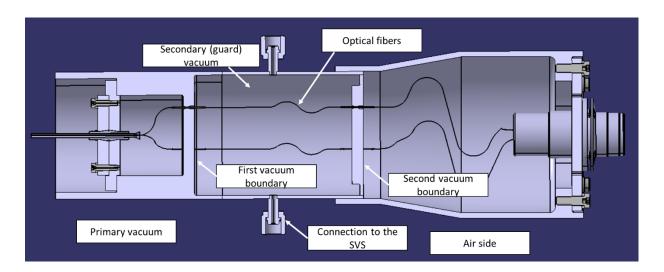


Figure 1 Optical Fiber Feedthrough architecture

The ITER Organization (IO) will provide to the Contractor the reference design of the system as well as related reference and applicable documents, e.g. final Design Description Document, CAD models and drawings at final design maturity.

The Contractor is responsible for the development of the OFF manufacturing design, for the OFF full-scale prototype manufacturing and qualification, for the welding and brazing qualifications and for the OFF series manufacturing. It includes demonstration that the produced and delivered OFF are fully compliant with this technical specification.

[REQ-1]

The Contractor shall demonstrate its capability to reproduce the design of the OFF delivered and tested during the previous R&D phase and for which IO has confirmed positive results, see [RD1], [RD2].

Alternatively, in the case where the Contractor proposes a design significantly changed compared to that already qualified, the design shall be validated on sample products by the Supplier.

2 Background

ITER is a large-scale scientific experiment that aims to demonstrate the technological and scientific feasibility of fusion energy. ITER is identified in France as a Nuclear Facility according to the INB order 7th February 2012 ("Installation Nucléaire de Base").

During its operational lifetime, ITER will test key technologies necessary for the next step: the demonstration fusion power plant that will prove that it is possible to exploit fusion energy for commercial use. ITER is based on the 'tokamak' concept of magnetic confinement, in which the plasma is contained in a doughnut-shaped Vacuum Vessel (VV). The fuel — a mixture of deuterium and tritium, two isotopes of hydrogen — is heated to temperatures in excess of 150 million °C, forming a hot plasma. Strong magnetic fields are used to keep the plasma away from the walls; these are produced by superconducting coils surrounding the vessel, and by an electrical current driven through the plasma.

The VV is a hermetically-sealed steel container that houses the fusion reaction and acts as a first safety confinement barrier. It operates at 100°C and can be baked up to 240°C to guarantee clean ultra-high vacuum needed to operate plasmas.

Internal components such as the Blanket, Divertor and First Plasma Protection Components are located inside the VV. They are equipped with Operational Instrumentation for measurement of thermal, mechanical and electromagnetic parameters during operation. These measurements are performed by two types of sensors:

- Optical strain sensors, linear displacement sensors, temperature sensors;
- Electrical Rogowski coils, magnetic flux loops, thermocouples.

The OFF allows transmission of measured signals from optical fiber sensors located in the VV to the data acquisition system by routing the optical fibers through the VV barrier. The Operational Instrumentation comprise 12 OFF - 9 in the Upper Ports of the VV and 3 in the Lower Ports.

The OFF have two vacuum boundaries with permanently pumped interspace between them.

The OFF implement the safety function of first confinement barrier (SIC-1) and are classified as PIC (Protection Important Component). This classification imposes strict requirements on the design, manufacturing, inspection and capability to withstand the loads during accidental events without failure of the component's safety function.

3 Definitions

CAD Computer Aided Design
CRN Contractors Release Note

DO Design Office
DR Deviation Request

DRR Delivery Readiness Review

EN European Standards

ESPN Équipement Sous Pression Nucléaire (Nuclear Pressure Equipment)

HP Hold Point

GAD General Assembly Drawing

INB Basic Nuclear Installation (from French "Installation Nucléaire de Base")

IEC International Electrotechnical Commission

IO ITER Organization

ISO International Organization for Standardization

IVH ITER Vacuum Handbook

MC Maintenance Class

MRR Manufacturing Readiness Review
MQP Management and Quality Program

ITER D 2Z89Z8 v1.7

NCR Non-Conformity Report
NDT Non-Destructive Test
NP Notification Point

OFF Optical Fiber Feedthrough
PIA Protection Important Activity
PIC Protection Important Component

RCC-MR Regles de Conception et de Construction des Matériels mécaniques des ilots nucléaires RNR, applicables aux structures à haute température (Design and construction code retained for the Vacuum Vessel)

PNI ITER Part Number VV Vacuum Vessel

SIC Safety Important Classification SRO Safety Responsible Officer SVS Service Vacuum System

WP Witness Point

For a complete list of ITER abbreviations see: ITER D 2MU6W5 - ITER Abbreviations

3.1 Definitions of terms used in this technical specification

PIC – Component important for protecting the interests of public security (including nuclear safety, radioprotection and prevention and fight against malevolent acts and civil security actions in the case of an accident), health and sanitation, the protection of nature and of the environment, i.e. structure, equipment, system (programmed or not), material, component or software that is present in the basic nuclear installation or that is under the responsibility of the nuclear operator and that implements a function required for the demonstration mentioned under the second paragraph of Article L. 593-1 of the Environmental Code or that ensures that this function is implemented per articles 1.3 and 2.5.1 of Order 7th February 2012.

PIA – Any activity which is related to or can impact a Protection Important Component.

Defined requirements – Any requirement that has been assigned to a Protection Important Component or a Protection Important Activity so that it may perform the function, with the characteristics expected, as specified in article 1.3 of the Order of 7 February 2012.

Upper Port Design OFF assembly – the type of assembly of the optical fiber feedthrough designed to accommodate up to 21 optical fibers. This type of assembly will be installed in the Upper Ports of the VV.

Lower Port Design OFF assembly – the type of assembly of the optical fiber feedthrough designed to accommodate up to 140 optical fibers. This type of assembly will be installed in the Lower Ports of the VV.

3.2 Definitions specified in RCC-MR 2007

The relevant definitions of the stakeholders are specified in RCC MR 2007 Section 1, Subsection A, Chapter RA 2000.

The ITER Organization is an Operator within the context of the RCC-MR Code in accordance with provisions of the mentioned Section, **Paragraph RA 2112**.

The Contractor in this Technical Specification is a Manufacturer within the context of the RCC-MR. Definition of a Manufacturer is outlined in the **Paragraph RA 2130** of above-mentioned Section.

The Sub-contractor in this Technical Specification is a Supplier within the context of the RCC-MR. Definition of a Supplier is outlined in the **Paragraph RA 2150** of above-mentioned Section.

Definition of an Inspector is outlined in the Paragraph RA 2170.

Definitions of Contractor and Sub-contractor as outlined in the **Paragraphs RA 2120** and **RA 2140** respectively are not applicable in the context of this Technical Specification.

4 Scope

4.1 Scope of work

The scope of work include the following activities:

- Phase I: Manufacturing design development
 - Verification of the reference design developed by IO
 - Production of the manufacturing design
 - Phase II: Qualification of the manufacturing processes
 - Qualification of the welding procedure
 - Qualification of the brazing procedure
 - Phase III: Environmental qualification
 - Manufacturing of a full-scale prototype
 - Environmental qualification
 - Phase IV: Manufacturing Readiness Review
- Phase V: Manufacturing of the Optical Fiber Feedthroughs
- Phase VI: Factory Acceptance Testing
- Phase VII: Delivery to IO site

The changes introduced to this technical specification for the Amendment #3 are marked with green font.

4.2 Scope of supply

In the frame of the contract two types of OFF assemblies shall be supplied. OFF assemblies "Upper Port Design" are intended to transmit 21 optical fibers and will be installed in the Upper Ports of the VV, as shown on Figure 2. OFF assemblies "Lower Port Design" transmit 140 optical fibers and will be installed in the Lower Ports of the VV, as shown on Figure 3.

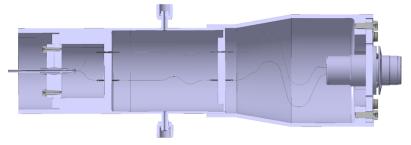


Figure 2 "Upper Port Design" Optical Fiber Feedthrough assembly

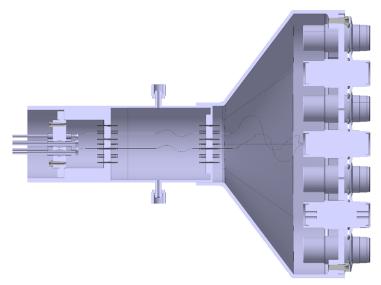


Figure 3 "Lower Port Design" Optical Fiber Feedthrough assembly

The quantity of the OFF assemblies of each type and of their main parts are listed in Table 1.

The detailed list of parts comprised within the OFF assemblies of both types are described in Section 6.1.

The OFF shall be delivered fully assembled.

	Description	Quantity of items (including one spare of each type)	Total max length of the optical fibers per assembly	Max length of the optical cables tubes per assembly	Quantity of the air-side connectors per assembly	Quantity of the SVS connection flanges
Upper Port Design OFF Assembly	OFF accommodating 21 optical fibers	10	82 m	2.5 m	2	2
Lower Port Design OFF Assembly	OFF accommodating 140 optical fibers	4	910 m	40.5 m	17	2
OFF full-scale prototype ¹	OFF full-scale prototype for qualification of manufacturing design	1	500 m	10 m	1	2
Total scope of proc spares)	urement (including	15	5.2 km	210 m	91	6

Table 1 Scope of supply

The distribution of the optical fibers and the lengths of the optical cables per each OFF assembly is indicated in the Appendix D "Optical Fiber Feedthrough Identification". The final lengths of the optical cables and optical fibers distribution inside them will be provided by IO by the time of the MRR. The final lengths will not differ from the length indicated in the Appendix D by more than 10%.

-

¹ The values for the full-scale prototype are indicative for purpose of estimation of the overall scope of procurement. The final values will be defined by the design of the full-scale prototype.

5 Structure of the Technical Specification

This Technical Specification constitutes the main document describing:

- The scope of the contract;
- The top level requirements that are applicable to the scope of the contract;
- The deliverables of the contract.

For traceability purpose, top level requirements specified in this document are identified using the following nomenclature [REQ-XXX], where XXX means the number of the requirement.

This technical specification comes with the Appendices listed below. The last approved version shall be considered as applicable.

Appendix	Title	IDM reference
A Component Drawings		2SX3KV [AD1]
B Welding Specification		<u>2VEGGR</u>
C Brazing Specification		2Z82VZ [AD3]
D Optical Fiber Feedthroughs Identification		<u>2Z86YG</u>

6 Optical Fiber Feedthrough design description

The OFF are designed to connect in-vessel and ex-vessel cables and allow transmission of measured signals from sensors located inside the VV to the data acquisition system, by routing optical fibers through the VV.

They are made of a 114 mm diameter stainless steel tube with a double barrier inside. Bundles of optical fibres are routed through the barriers being inserted in small diameter tubes (1.6 mm in the reference design) that are brazed to the stainless plate. The sealing of the fibers inside the small diameter tube is ensured by brazing of the fibers to the tubes. The pressure between the 2 barriers is continuously monitored by Service Vacuum System (SVS) which also implement leak detection and leak localization function.

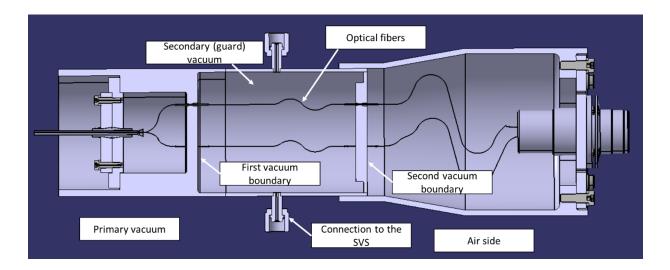


Figure 4 Optical Fiber Feedthrough layout

6.1 List of parts

The parts comprised with the OFF assembly are identified on the Figure 5. The internal structure of the OFF assemblies of Upper Port Design and Lower Port Design are similar in terms of parts, the difference is in the parts quantities.

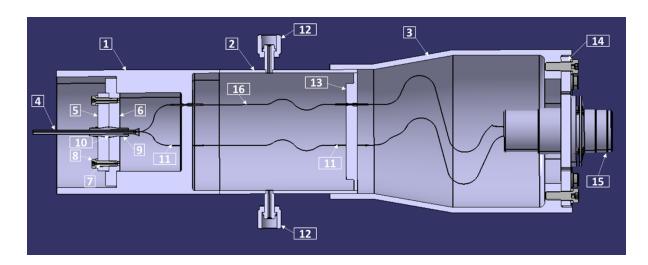


Figure 5 Optical Fiber Feedthrough parts identification

The description and quantity of the OFF parts are shown in the Table 2.

Number	Description	Quantity per Upper Port Design assembly	Quantity per Lower Port Design assembly	Standard component ²
1	First supporting cylinder (first vacuum boundary)	1	1	N
2	Second supporting cylinder	1	1	N
3	Third supporting cylinder	1	1	N
4	Optical cable	1	8	N
5	Optical cable alignment plate 1	1	1	N
6	Optical cable alignment plate 2	1	1	N
7	Bolts	8	8	N
8	Washers	8	8	Y
9	Optical cable support (comprises two equal halves)	1	8	N
10	Ring for fixation of optical cables support	1	8	N
11	Tube with optical fibers	3	20	N
12	Connection flange to the SVS	2	2	Y
13	Vacuum plate (second vacuum boundary)	1	1	N
14	Connectors support plate	1	1	N

Table 2 Description and quantity of the OFF parts

² The component is classified as "standard" if it can be procured off-the-shelf and no custom machining is needed.

⁻

15 Air-side connectors	2	17	Y]
------------------------	---	----	---	---

6.2 Operating conditions

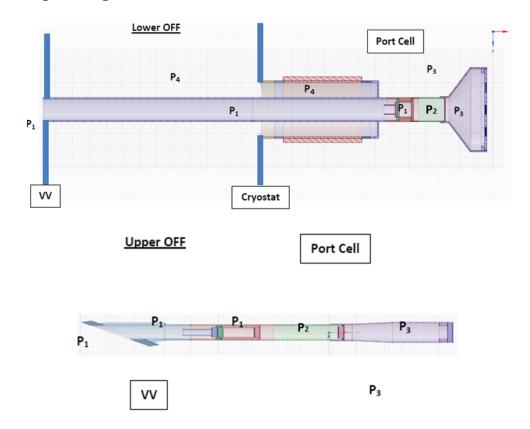


Figure 6 Sketch of the OFF Pressure environment

Table 3 Temperature and Pressure environment of the OFF during operation

Parameter	Plasma operation	Baking	Maximum value ³
Temperature, °C	100	200	300
Pressure, MPa	$P_1 = 0$	$P_1 = 0$	$P_1 = 0.3$
	$P_2 = 0.05$	$P_2 = 0.05$	$P_2 = 0.05$
	$P_3 = 0.1$	$P_3 = 0.1$	$P_3 = 0.3$

Level of irradiation in the locations of the OFF is not expected to impact the properties of the selected materials of the OFF, it is assumed that the maximum allowable damage will not exceed 0.5 dpa (displacements-per-atom).

[REQ-1]

However, the Contractor shall consider the radiation conditions in manufacturing design development. For the OFF location, the level of 14 MeV neutron radiation is estimated to be 10⁵ n/cm²/s which correspond to the dose level of 10 Gy. The total dose level for neutron and gammaradiation in the locations of the OFF is 1 MGy.

³ Maximum value is considered as conditions during accidental event

6.3 Dimensions

The nominal dimensions of the Upper Port Design and Lower Port Design OFF assemblies are indicated on the components drawings in the Appendix A "Component Drawings".

6.4 Interfaces

The OFF interface with the following components of the machine during the ITER operation:

- Vacuum Vessel OFF is welded to the VV stubs in the Upper Ports and VV Port Extensions in the Lower Ports;
- Service Vacuum System The Vacuum Pumping System provides vacuum in the torus, cryostat, and auxiliary systems, including diagnostics at the level necessary for the operation of ITER. The physical interface occurs at the SVS Pipe that connects to the OFF. The OFF is connected to the SVS through the SVS connection flanges (#12 on Figure 5);
- Ex-vessel cables cables from the air-side connectors of the OFF to the data acquisition system (#15 on Figure 5).
- Optical in-port connectors optical connectors located inside the ports of the VV and intended to connect the optical fibes of in-vessel cables with fibers of the OFF.

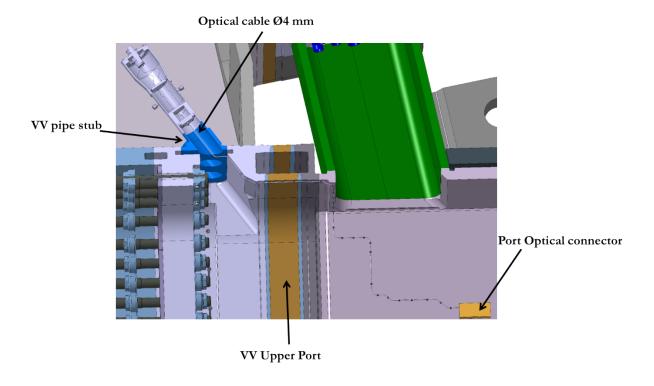


Figure 7 "Upper Port Design" OFF assembly interfaces

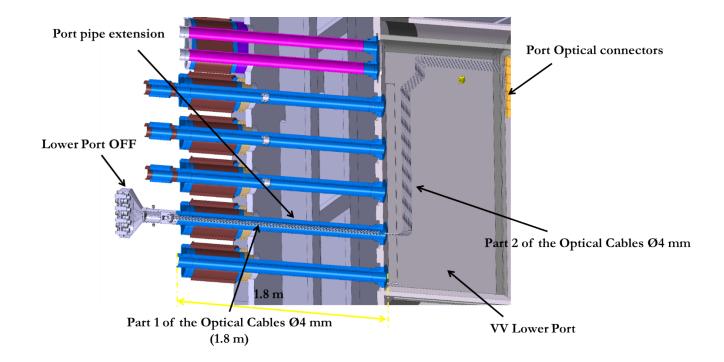


Figure 8 "Lower Port Design" OFF assembly interfaces

7 Classification requirements

This section outlines the specific requirements imposed by the OFF classification.

Classification Class Safety Class PIC/SIC-1 **Quality Class** QC 1 Vacuum Quality Class VQC-1A Seismic Class SC 1 TC 2B **Tritium Class** N/A^4 **ESPN** RCC-MR Class II Box structures

Table 3 Component classification

7.1.1 Safety classification

The OFF are classified as Protection Important Components (PIC-1). They interface with ITER Vacuum Vessel and form part of the primary confinement boundary.

The OFF are specifically SIC-1, the components defined as "those required to bring and to maintain ITER in a safe state".

⁴ ESPN non-classified, but OFF are welded to the Vacuum Vessel which is ESPN

Table 4 Safety function to be fulfilled by the Optical Fiber Feedthrough

Safety Function		Detailed Safety Functions	
1	Confinement of radioactivity and Beryllium ⁵	1b)	Building confinement barriers

7.1.2 Quality Assurance Classification

The OFF as PIC components are Quality Class 1 (QC1). QC1 criteria belong to any safety related class item or any item whose failure/malfunction could result in extensive machine downtime. All quality requirements resulting from this categorization are included in this Technical Specification.

7.1.3 Vacuum Quality Classification

Vacuum Class VQC 1A is assigned to the OFF according to the ITER Vacuum Handbook [AD5]. VQC 1A components are defined as Torus primary vacuum components and which form a part of the vacuum boundary.

The vacuum quality classification has many implications on the design and manufacturing requirements of the OFF.

[REQ-2]

The Contractor shall design and manufacture the OFF according to the requirements applicable for the VQC-1A components. The main vacuum quality requirements are incorporated in this Technical Specification.

The exhaustive list of vacuum quality requirements is established in the ITER Vacuum Handbook and its Appendixes:

- ITER Vacuum Handbook ITER D 2EZ9UM ITER Vacuum Handbook
- Appendix 2 Environmental Cleanliness ITER D 2EL9Y6 Appendix 2 Environmental Cleanliness
- Appendix 3 Materials ITER_D_27Y4QC Appendix 3 Materials
- Appendix 4 Accepted Fluids ITER D 2ELN8N Appendix 4 Accepted Fluids
- Appendix 10 Vacuum Cables ITER D 2ETNLM Appendix 10 Vacuum Cables
- Appendix 12 Leak Testing ITER_D_2EYZ5F Appendix 12 Leak Testing
- Appendix 13 Cleaning and Cleanliness ITER D 2ELUQH Appendix 13 Cleaning and Cleanliness

7.1.4 Seismic Classification

The OFF is classified as SC1 (S).

[REQ-3]

Structural stability of OFF shall be maintained in the event of an earthquake, i.e. no rupture of piping, no collapse of structures, limited plastic strain. No deformation of the OFF shall prevent other SIC-1 and SIC-2 components to perform their safety functions.

The ability of the OFF to perform its safety function during the seismic event shall be verified by the qualification test as required in Section 10.3.2.

⁵ Decree 2012/1248 part III.1: The confinement is also applicable to beryllium confinement

7.1.5 Tritium Classification

The OFF are classified as TC-2B which means "Non pressure coded first static barrier". The requirements imposed by tritium classification are covered by the requirements to the VQC1 components. No special requirements are applicable.

7.1.6 RCC-MR Classification

The OFF is classified according to the RCC-MR 2007 as class 2 box structure. For the requirements imposed by the RCC-MR 2007 standard refer to the Appendix B Welding Specification.

8 Codes and Standards

The standards applicable at the different stages of the contract execution are summarized in the Table 5:

Standard **Description** RCC-MR 20076 Design and construction rules for mechanical components of nuclear installations EN 10204:2004 Metallic products - Types of inspection documents Electrical Penetration Assemblies in Containment Structures IEEE 317-2013 for Nuclear Power Generating Stations IEC 60068-3-3 Seismic test methods for equipment IEEE 323-2003 IEEE Standard for Qualifying Class 1E Equipment for **Nuclear Power Generating Stations** IEC 60793-1-40 Optical fibres - Part 1-40: Measurement methods and test procedures - Attenuation IEC 60793-1-31 Optical fibers – Measurement methods and test procedures -Tensile strength Electrical insulation materials – Thermal IEC 60216-1: 2013 endurance properties. Part 1: Aging procedures and evaluation of test results EN 13134: 2000 Brazing. Procedure Approval EN ISO 13585: 2012 Brazing - Qualification test of brazers and brazing operators ISO 18279 Brazing — Imperfections in brazed joints EN 12797 Brazing — Destructive tests of brazed joints

Table 5 Applicable standards

EN 12799

EN ISO 9712: 2012

EN ISO 9606-1:2013

(superseded EN 287-1:2011)

NDT personnel

Brazing — Non-destructive examination of brazed joints

Non-destructive testing — Qualification and certification of

Qualification test of welders – Fusion welding – Part1: Steels

⁶ Appendix B Welding Specification defines specific Sections, Subsections and Chapters of the RCC-MR 2007 applicable for the design, qualification, manufacturing and testing.

EN ISO 9712:2012	Non-destructive testing – Qualification and certification of NDT personnel – General principles
EN ISO 14732:2013	Welding Personnel – Approval testing of welding operators for fusion welding and resistance weld setters for fully mechanized and automatic welding of metallic materials
ISO 17025 :2005 +AC1:2006	General requirements for the competence of testing and calibration laboratories
ISO 2768-1	General tolerances. Part 1: tolerances for linear and angular dimensions without individual tolerance indications.
ISO 2768-2	General tolerances. Part 2: geometrical tolerances for features without individual tolerance indications.
EN ISO 6892-1:2009	Metallic materials – Tensile testing – Part 1: Method of test at room temperature
EN ISO 6892-2:2011	Metallic materials – Tensile testing – Part 2: Method of test at elevated temperature
EN 10216-5:2013	Seamless steel tubes for pressure purposes – Technical delivery conditions. Part 5: Stainless steel tubes

9 Manufacturing Design Development

9.1 Design verification

[REQ-4]

The purpose of this task is to analyze the reference design developed by IO and provided to the Contractor as input data. The design shall be analyzed against following aspects:

- Manufacturability
- Assembly process
- Maintainability
- Inspectability
- Vacuum quality
- Temperature resistance characteristics
- Compliance with RCC-MR requirements
- The result of this study shall be a proposal of improvements (if any) of the reference design submitted to IO for acceptance.

[REQ-5]

In particular, the Manufacturability assessment shall include the following steps:

- Detection of possible manufacturing problems
- Selection of the materials
- Selection of the manufacturing processes
- Preliminary design of assembly process of the OFF

Manufacturability assessment shall lead to the optimization of the manufacturing and assembly processes and manufacturing cost improvement.

The result of this assessment shall be a proposal of the manufacturing design submitted to IO for acceptance.

9.2 Manufacturing Design Requirements

9.2.1 Optical fibers requirements

[REQ-6]

Optical fibers in each OFF assembly shall comply with the requirements defined in Table 6.

Table 6 – Requirements for optical fibers

Parameter	Requirement
Type of optical fiber	Single mode
Wavelength	1500 - 1600 nm
Attenuation at 1550 nm, dB/km	≤ 7
Cladding diameter	$125 \pm 1 \mu m$
Coating diameter	$165 \pm 5 \mu m$
Coating composition	>99% copper
Bending radius	> 15 mm

[REQ-7]

The optical fibers used in the OFF shall be radiation resistant.

Total neutron fluence and gamma-radiation dose for optical fibers inside the Vacuum Vessel may reach at the end of ITER operations $F \sim (10^{18}-10^{20})$ n/cm² and $D \sim (10^7-10^9)$ Gy.

A dedicated irradiation campaign was organized in the nuclear reactor IVG-1M in Kazakhstan in 2019. During the campaign, the radiation hardened optical fibers from several suppliers were tested. The Radiation Induced Attenuation (RIA) was measured to assess the impact of radiation on measurement accuracy.

As a result, one or both of the following suppliers shall be selected for the procurement of the optical fibers to be used in the OFF:

Company name	Contacts	
IVG Fiber, Canada	www.ivgfiber.com, (416)848 0258	
FORC Photonics, Russia	www.forc-photonics.ru, info@forc-photonics.ru	

[REQ-8]

Minimum bending radius of optical fibers shall be 15 mm.

9.2.2 Materials requirements

Materials used for OFF manufacturing are restricted by the vacuum requirements.

[REQ-9]

All material, fluids, tapes, markers, grinding wheels etc. used on the component (including those used during machining, welding and NDT operations) shall be in accordance with ITER VHB for use on VQC-1A components. If materials used in vacuum are not included in the IVH, the appropriate proposal shall be submitted and approved by the ITER Vacuum RO before the manufacturing.

[REQ-10]

One of the following grades of the stainless steel shall be used in the OFF manufacturing:

- Steel type 316L (1.4404)
- Steel type 304L(1.4307)

[REQ-11]

Procurement of materials shall be in accordance with the following EN standards (or their equivalents):

EN 10216-5 – for stainless steel tubes

EN 10028-7 – for stainless steel flat products

EN 10222 – for steel forgings

[REQ-12]

Components fabricated from the grades of Stainless Steel shall not exceed the following limits of impurities:

- 0.20 weight % Cobalt
- 0.10 weight % Niobium
- 0.05 weight % Tantalum

[REQ-13]

All materials to be used for the qualification purposes and subsequent fabrication, shall be procured with their inspection documents. In particular, the certificate type 3.1 in accordance with EN 10204 shall be provided.

[REQ-14]

Scope of mechanical tests, apart from tests at room temperature (20° C) in accordance with EN ISO 6892-1:2009, shall also include tensile tests at elevated temperature (in accordance with EN ISO 6892-2:2011). Tensile tests shall be performed at 250° C.

[REQ-15]

All brazing consumables, i.e. filler, flux, stop-off etc. shall be compatible with requirements for impurities content specified in [REQ-12] and vacuum requirements specified in the Section 9.2.3.

Additionally, the requirements for procurement of welding consumables are specified in the Appendix B Welding Specification.

9.2.3 Vacuum design requirements

[REO-16]

Crevices, blind holes, cracks, trapped volumes, etc., shall be avoided as these will act as dirt and liquid traps and will prevent pumping performance.

[REQ-17]

The design of brazed joints shall be such as to minimize the risk of trapped volumes.

[REQ-18]

The bolts for use in vacuum shall be locked after loading to prevent them becoming free and causing damage to other parts of the vacuum system.

[REQ-19]

Bolts shall be treated to prevent seizing. The bolts shall be coated with copper (purity of 99.9 %) by the process of electrodeposition. An intermediate nickel bond coat shall be deposited prior the copper coating.

The Nickel plating shall have 1 μ m average thickness (+/- 10%).

The Copper coatings shall have 5 µm average thickness (+/- 10%).

[REQ-20]

The maximum acceptable leak rate as defined for the VQC 1 components shall not exceed $1x10^{-10}$ Pa.m³/s air equivalent. All leak tests performed during the contract execution shall use this value as acceptance criteria. Leak tests shall be performed at room temperature (20 °C), operating temperature (100 °C) and maximum (baking) temperature (240 °C). The component shall be subjected to three thermal cycles from room to baking temperature prior to the leak test. Section 10.3.2 for Qualification tests and Section 13 for Factory Acceptance Test describe the environmental parameters for the leak tests.

[REQ-21]

The outgassing rate of materials used in the OFF shall not exceed maximum steady state outgassing rate at outgassing temperature 100° C:

- 1x10⁻⁷ Pa.m³.s⁻¹.m⁻² for Hydrogen isotopes
- 1x10⁻⁹ Pa.m³.s⁻¹.m⁻² for impurities

[REQ-22]

The optical fibers alignment plates (#5, #6 on the Figure 5) shall have additional holes to ensure the pumping from the torus vacuum side and connectors support plate #14 shall have holes to ensure introducing of helium during the He leak test of the second barrier.

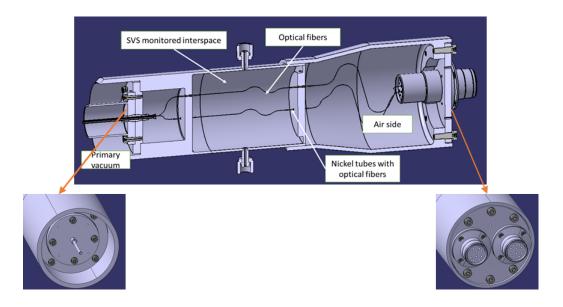


Figure 9 OFF with holes for pumping and He leak test

[REQ-23]

The design of bolts used on the vacuum side of the OFF shall be compatible with high vacuum environment (e.g. to have additional holes to avoid trapped volumes and to ensure pumping).

9.2.4 Optical cables tubes design

[REQ-24]

Optical cables tubes shall have an outer diameter 4mm (-0, +0.05mm) and inner maximal diameter 3 mm.

[REQ-25]

Minimum bending radius of the optical cable shall be 15 mm.

[REQ-26]

The length of the optical cables tubes shall be equal to their nominal length as to be confirmed by IO at MRR with a tolerance of \pm 10 mm for cable lengths \pm 5 m and \pm 10 mm for cable lengths \pm 5 m.

[REQ-27]

The material of the optical cables tubes shall be stainless steel in accordance with the material requirements from Section 9.2.2. The stainless steel tubes shall be procured in accordance with the standard EN 10216-5. The stainless tubes shall be solution annealed.

[REQ-28]

The terminations of the optical cables tubes shall be machined to prevent damaging of the optical fibers by sharp edges.

9.2.5 SVS connection flanges design

[REO-29]

The OFF shall accommodate two SVS connection flanges for connection to the ITER Service Vacuum System. The SVS connection flanges shall be placed symmetrically on the OFF body.

[REQ-30]

The identified commercial connector's assembly for the connection to the SVS monitoring system, agreed with the interfacing ITER Vacuum system, is taken from Swagelok Catalogue [AD21]. The items and their ordering numbers which shall be supplied as part of the OFF assemblies are identified in the Table 7.

Table 7 SVS connection flanges components

Item	Ordering Number	Material	Quantity
Female Nut	SS-4-VCR-1	316L	2
Gland Male Weld	SS-4-VCR-3-4 MTW	316L	2

[REQ-31]

The Contractor shall also procure the plugs and gaskets for protection of the flanges and interspace during transportation and storage.

9.2.6 Air-side connectors design

[REQ-32]

The connectors shall be located on the air side of the OFF for demountable connection with the optical cables coming from the data acquisition system.

[REO-33]

The connectors shall have sufficient number of pins to accommodate all number of optical fibers in the OFF assemblies.

The type of the air-side connectors recommended for use by IO is LEMO F2 or F7 Fiber Optic Contact 5K series. For design details and ordering information refer to the LEMO catalogue of Fiber Optics Connectors: https://www.lemo.com/catalog/ROW/UK_English/f7 contacts.pdf

9.2.7 Weld Design

The reference design of the OFF contains a number of welds categorized following provisions of the RCC-MR 2007 code.

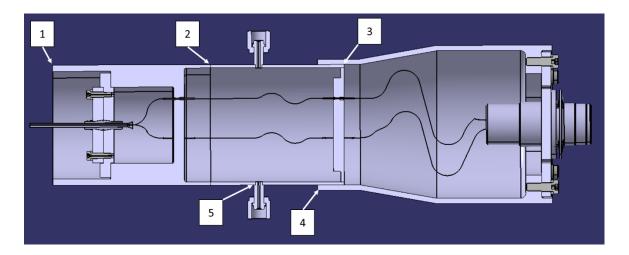


Figure 10 Optical Fiber Feedthrough welded joints

The welds are categorized as follows:

Welds #1, #2, #3 – Cat II

Welds #4, #5 – Cat IV

[REQ-34]

Welding joints design shall comply with provisions of the RCC-MR 2007 Section I, Subsection C specified for the box structure components of the class 2.

[REO-35]

Manufacturing design of the component shall allow required NDT to the extent specified. Welds which can't be inspected, are not permitted.

[REQ-36]

Design shall allow execution of the He leak testing of each OFF assemblies at the final stage of fabrication.

[REO-37]

The welds shall be designed in accordance with Appendix B Welding Specification.

[REO-38]

Final welding documentation as requested in the Appendix B and outlined in Section 17 shall be accepted by IO prior to delivery of the components on site.

9.2.8 Maintenance and Inspection Plan

[REQ-39]

The Maintenance, Test and Inspection Plan shall be provided for the developed manufacturing design of the Optical Fiber Feedthrough.

The OFF implements the safety function "First confinement barrier", therefore following safety requirements shall be applied:

- Maintenance procedures required to demonstrate that safety function is implemented shall be specified and executed.
- Maintenance procedures shall demonstrate the compliance with design code requirements.
- Maintenance, Test and Inspection plan shall include in-service inspections, monitoring and/or tests or compensatory measures taken to ensure that the OFF can continue to provide its safety function with the required level of reliability.
- Test records, personnel training requirements, etc to be specified as part of the maintenance procedures.

[REQ-40]

The Maintenance, Test and Inspection Plan shall define preventive and corrective maintenance tasks.

Preventive maintenance consist of routing activities to ensure that there is no degradation or damage of the components.

Corrective maintenance defines activities to be performed in case of failure of the safety function and consist in applying the repair procedure.

[REQ-41]

The maintenance tasks defined in the Maintenance, Test and Inspection Plan shall be classified according to the maintenance classification:

- Maintenance Class 1 (MC1) shall be associated to any maintenance task which requires use of Remote Handling equipment or Human-assisted equipment.
- Maintenance Class 2 (MC2) shall be associated to any maintenance task which is not classified as MC1 and which requires special PPE (Personal Protective Equipment) for workers, such as air suit or breathing mask.
- Maintenance Class 3 (MC3) includes any planned or unplanned maintenance activities that are not classified as MC1 or MC2.

[REQ-42]

The specification of each maintenance task shall include as minimum:

- The scope and workflow of actions to be performed;
- Applicable standards (if exist);
- The acceptance criteria for each maintenance task;
- Number of personnel required to perform the task;
- Identification of tools required to perform the task.

[REQ-43]

All maintenance, test and inspection records shall be recorded and archived. The Contractor shall provide the template for maintenance records. This template shall include as minimum:

- Date of the maintenance;
- Reason for maintenance;
- Type of the maintenance scheduled/unscheduled;
- Component's tag: Functional Reference, PNI, Serial Number;
- Component's classification: PIC, VQC, QC, etc;
- Performance of the maintenance (performed inspections and tests with results);
- Damages found, reasons for repair;
- List of performed operations;
- Identification of hazardous/toxic materials. Dose rate in case of hand-on maintenance in the port cell.

9.2.9 CAD Requirements

[REQ-44]

The Contractor shall provide a Design Plan to be approved by the IO. Such plan shall identify all design activities and design deliverables to be provided by the Contractor as part of the contract.

[REQ-45]

The Contractor shall ensure that all CAD Data (Schematics, Models and Drawings) delivered to IO comply with the ITER_D_2F6FTX - Procedure for the Usage of the ITER_CAD Manual [RD9], and with the ITER_D_2DWU2M - Procedure for the CAD management plan [RD10]. IO DO (Design Office) and Contractor shall use the CATIA version indicated in the latest version of the ITER CAD Manual released by IO DO, CATIA V5 (R28 SP2 currently).

[REQ-46]

The Contractor is proposed to work in asynchronous collaboration scheme, where the Contractor will work on "File-based". See detailed information about asynchronous collaboration scheme in the ITER direct contracts [RD11]. This implies the usage of the CAD software versions as indicated in ITER_D_249WUL-CAD Manual 07-CAD FactSheet [RD12]. Any deviation against this requirement shall be defined in a Design Collaboration Implementation Form (DCIF) prepared and approved by IO DO [RD13]. Any cost or labour resulting from a deviation or non-conformance of the Contractor with regards to the CAD collaboration requirement shall be incurred by the Supplier.

10 Qualification

10.1 Qualification of brazing procedure

The objective of the qualification program is to develop and qualify the brazing procedure, which at once:

- Ensures component performance as far as safety requirements concern;
- Preserves functionality of the optical fibres;
- Satisfies requirements of applicable codes and standards;
- Ensures repeatability of the result during manufacturing.

The qualification program includes:

- Qualification of the brazing procedure through the qualification tests;
- Qualification of the brazing personnel;
- Production of the Brazing Procedure Specification.

[REQ-47]

Qualification of the brazing procedure shall be done according to the requirements specified in the Appendix C Brazing Specification.

The Appendix C defines the requirements for:

- Applicable and Reference standards;
- Design of the mock-up for qualification;
- Qualification tests and acceptance criteria;
- Brazing Data Package.

[REQ-48]

Brazing procedure specification and related quality control procedure, developed and accepted by IO during qualification of the brazing, shall be integrated in the manufacturing and inspection plan.

[REQ-49]

Qualification of brazing procedure shall be witnessed by ITER recognised Independent Inspection Authority (IIA).

The detailed requirements that shall be applied to the all stages of the qualification are listed in the Appendix C Brazing Specification.

10.2 Qualification of welding procedure

[REQ-50]

The welding procedures used for the OFF manufacturing shall be properly qualified in accordance with the RCC MR, SECTION IV for Class 2 welds and additional requirements specified in the Appendix B.

[REQ-51]

Qualification of welding procedure shall be witnessed by ITER recognised Independent Inspection Authority (IIA).

[REO-52]

Execution of production welds shall be performed only by welders and operators who possess suitable qualification as specified in the Appendix B.

[REQ-53]

Qualification of each welding procedure shall be subject to IO approval before fabrication of components can start.

The detailed requirements that shall be applied to the all stages of the qualification are listed in the Appendix B Welding Specification.

10.3 Environmental Qualification

10.3.1 Manufacturing of the full-scale prototype

[REQ-54]

The Contractor shall propose a design of the full-scale prototype for the IO acceptance.

|REQ-55|

The full-scale prototype for qualification shall include all elements that affect the performance of confinement function and functionality of the OFF to transmit signals:

- All internal welds;
- Brazed joints;
- Optical fibers;
- Internal support structures.

[REQ-56]

The full-scale prototype shall meet the following requirements:

- The full-scale prototype shall be representative of the same design as the serial production. Any differences shall be identified and shall not affect performance of the safety function.

- The full-scale prototype shall be manufactured using production facilities and processes as for serial production units;
- The full-scale prototype shall have the same configuration as to produce thermal and mechanical stresses representative of the design being qualified;
- Materials of the full-scale prototype shall be the same or equivalent to the OFF serial production ice.
- The full-scale prototype shall include a maximum number of brazed joints to be as high as possible representative of the final component (NB.:. OFF includes a maximum of 20 bundles of optical fibers).
- The full-scale prototype shall include at least one air-side connector.
- The full-scale prototype shall be assembled in a manner and a position that simulates it's expected installation. Any mounting limitations shall be specified in the test report.

10.3.2 Qualification tests of the full-scale prototype

The qualification tests are divided in two groups: functional tests and environmental tests. Functional tests check the performance of the system with respect to the functional requirements - leak tests and optical insertion loss tests. Environmental tests simulate operational and accidental loads of the OFF and require functional tests afterwards to check that functional requirements are still met.

> Functional tests:

- Helium leak test
- Insertion loss test (this test is performed for validation of characteristics of the optical fibers in the feedthrough and it's not related to the performance of safety function)
- Pull test of optical fibers

Environmental tests:

- Preconditioning
 - Thermal cycling test
 - Thermal aging
 - Pressure load test
 - Operational vibration test
- Design basis events tests
 - Seismic test
 - Fire resistance test
 - Pneumatic pressure test
 - Mechanical shock test

The reference standards for the OFF qualification are the following:

- **IEEE 323-2003** Standard for Qualifying Class 1E Equipment for Nuclear Power Generating Stations
- **IEEE 317-213** Standard for Electric Penetration Assemblies in Containment Structures for Nuclear Power Generating Stations (Clause 6 Qualification)

Table 8 Qualification tests for the full-scale prototype

Test name	Test objective	Test description	Reference standard	Acceptance criteria
Functional tests:				

Helium leak test	Validation of containment integrity of the feedthrough	Measurement of the leak rate. Feedthrough interspace is pumped up to pressure of 10 ⁻³ Pa.	Appendix 12 of the IVH [AD10]	Maximum leak rate for OFF is 10^{-10} Pa.m ³ /s air equivalent
Insertion loss measurement	Validation the capability of the feedthrough to transmit optical signals	Measurement of the optical power in the fibers	IEC 60793-1-40	Insertion losses shall not exceed 1 dB at room temperature (20°C) and 2 dB at operating temperature (100°C).
Pull test	Check the tensile strength of the fiber and the strength of the fiber fixation inside the OFF	Applying 3 cycles of 5N force for 10 s	IEC 60793-1-31	Optical losses are ≤ 1 dB at room temperature
Environmental test	s:			
Operational vibration test	Simulation of the inertial operation loads and evaluation of the impact on the feedthrough performance	Test shall produce a test response spectrum larger than the required response spectrum (will be provided as input).	IEC 60068-3-3	Functional tests
Thermal cycle test	Applying three thermal cycles, simulation of the differential pressure load during normal operation and assessment of the leak tightness	Pumping of the feedthrough interspace up to the pressure of 10 ⁻³ Pa. The prototype is subjected to three thermal cycles from ambient temperature (20°C) to baking temperature (240°C). During the last cycle, the leak test is performed at three temperatures: - 240°C; - 100°C (OFF operating temperature); - 20°C. The time taken to reach the specified bake temperature from ambient shall be less	ITER Vacuum Handbook [AD5] Appendix 12 of the IVH [AD10]	Functional tests
Thermal aging test	Test full-scale prototype shall be thermally age conditioned to simulate	than 100 hours. The full lifetime of the component shall be considered (30000 hours at 240 °C) ⁷	IEC 60216-1	Functional tests

⁷ It is proposed to perform accelerated aging tests with higher temperature and a reduced duration once the brazing solder will be identified and the maximum acceptable temperature defined. For example, if the brazing solder can resist to 340 °C aging temperature, the corresponding duration would be 30 hours. The temperature and the duration of the aging tests shall be mutually agreed between the contractor and the IO.

	operation for the installed life.			
Seismic test (SL-2 accident)	Simulation of the seismic event SL-2 and evaluation of the impact on the feedthrough performance	Test shall produce a test response spectrum larger than the required response spectrum (will be provided as input).	IEC 60068-3-3	Functional tests
Fire resistance test (Internal fire accident)	Simulation of the fire event and evaluation of the impact on the feedthrough performance	Fire resistance test simulates the fire event and consists on subjecting one of the barriers of the full scale prototype to a continuous temperature of 300°C for 120 minutes.	TBD by test procedure	Functional tests
Pneumatic pressure test (LOCA and VV ICE accidents)	Simulation of the LOCA and VV ICE accidents and evaluation of the impact on the feedthrough performance	Test simulates accidental pressure loads and consists on applying of 0.3 MPa to the first and second boundary of the feedthrough. The pressure in the feedthrough interspace is 10-3 Pa.	ASME Boiler and Pressure Vessel Code, Section III, Division 1, Subsection NE, Article NE-6000 2019	Functional tests
Impact test	Simulation of the accidental mechanical shock and evaluation of the impact on the feedthrough performance	Application to the full-scale prototype of a prescribed number of impacts defined by their impact energy and applied in the prescribed directions.	IEC 60068-2-75	Functional tests

[REQ-57]

Leak test and insertion loss measurement shall be carried out before environmental test sequence after each environmental test.

[REO-58]

Pull test shall be carried out before and after environmental test sequence.

[REO-59]

Upon completion of qualification tests, the Contractor shall issue the Qualification Synthesis Report according to [RD7].

11 Manufacturing Readiness Review

The main objective of the MRR is to verify the feasibility, manufacturability and reliability of the manufacturing design. Main topics of the review are the following:

- CAD data of the manufacturing design (DM, GAD, manufacturing drawings);
- MIP and manufacturing procedures;
- Implemented qualification program;
- Results of full-scale prototype qualification campaign;
- Time schedule of production phase;
- Quality control program to be implemented during production phase.

The MRR shall follow the procedure <u>ITER_D_44SZYP - Working Instruction for Manufacturing Readiness</u> Review .

[REQ-60]

It shall be demonstrated at the MRR that the manufacturing design satisfies all requirements of this technical specification.

[REQ-61]

It shall be demonstrated that manufacturing design is complete, technically correct, constructible and that the manufacturing is ready to start without incurring unacceptable risks.

[REQ-62]

The documents that shall be provided by the time of MRR are identified in Section 15 Deliverables and due dates.

[REQ-63]

The preparation of the MRR shall be entirely under the responsibility of the Contractor. It may be carried out as in-person meeting at the Contractor's or IO premises.

12 Manufacturing requirements

12.1 Fabrication processes

12.1.1 Cleanliness and vacuum quality requirements

Cleanliness and preservation of cleanliness are required during the whole manufacturing process. All components must be subjected to a rigorous cleaning procedure, consistent with the Vacuum Classification.

[REQ-64]

Storage of welding/brazing materials shall comply with provisions of RCC-MR Section 5 RS 7200.

Storage of raw stainless steel materials shall comply with storage requirements specified in the Appendix B (chapter 1.7.6)

[REQ-65]

All OFF shall be cleaned to Ultra High Vacuum Standards. Standard cleaning procedure for Stainless Steel components is described in Appendix 13 of IVH.

[REQ-66]

Work area within the workshop perimeter shall be at least of the level II (class B) according to the RCC-MR (Clause RF 6242) or higher.

Workshop shall be compatible with requirements regarding contamination as listed in RCC MR 2007, Section V, Clause RF 6400.

[REO-67]

Forming tools shall be cleaned thoroughly before use to avoid cross contamination. All lubricants used in the forming operations shall be removed from the workpiece. Only tools dedicated to stainless steel shall be employed; this particularly applies to grinding wheels and wire brushes.

The requirements regarding cleanliness during manufacturing listed in Appendix B Chapter 4.2 are applicable at each stage of the manufacturing.

[REO-68]

All OFF assemblies shall be subjected to a rigorous cleaning procedure, consistent with VQC 1A. Extra washing and polishing can be applied for better quality.

[REQ-69]

A detailed Clean Work Plan shall be submitted by the Supplier for prior acceptance by the IO before any cleaning operations are undertaken at the Supplier's site. The Clean Work Plan shall specify how cleanliness will be maintained throughout the manufacturing process of the OFF. The Clean Work Plan shall state when specific cleaning procedures will be applied to the OFF and all of the controls which will be in place to maintain cleanliness of the OFF including handling.

[REQ-70]

Parts and sub-components shall be degreased using solvents or alkaline detergents (using one of the accepted cleaning fluids for VQC 1A usage given in Appendix 4 of the ITER VHB), rinsed with demineralized water, and dried in hot gas or an oven to accepted procedures.

[REQ-71]

Halogenated solvents shall not be used at any stage of the manufacturing.

[REQ-72]

Abrasive techniques to clean or to attempt to improve the appearance of the surface of the OFF shall be kept to an absolute minimum and preferably avoided. The use of grinding wheels, wire brushes, files, harsh abrasives, sand, shot or dry bead blasting, polishing pastes and the like is prohibited.

[REQ-73]

Acid treatment of any sort is to be avoided as it may result in degradation of vacuum performance.

[REQ-74]

If pickling of steel or copper components is performed, this shall be followed by passivation.

[REQ-75]

Pickling and passivation shall be followed immediately by an appropriate cleaning process.

[REO-76]

Powder free latex or nitrile gloves (over cotton or linen if desirable) shall always be used when handling components. Colored gloves are not acceptable.

[REQ-77]

After final cleaning of the OFF, the Supplier shall perform a wet wipe test using the procedure described in Appendix 13 of the ITER VHB.

After the component has been cleaned and is completely dry, it shall be packed carefully to ensure that it remains clean and free from damage.

[REQ-79]

The supplier shall have the responsibility of ensuring that all staff fully understand all health and safety information issued by the manufacturer or supplier of any chemical or equipment to be used. Neither ITER nor any of its agents shall be responsible for any consequences arising from the application of any cleaning process described in this handbook unless it is under their direct control.

12.1.2 Surface finish requirements

[REO-80]

The maximum average surface roughness of metallic surfaces shall not exceed 6,3 μm measured by electric stylus. Surface roughness is defined in accordance with ISO 4287: 2000.

[REQ-81]

Abrasive techniques to clean or to attempt to improve the appearance of the surfaces of vacuum components shall be kept to an absolute minimum and are preferably avoided.

[REQ-82]

The use of files, harsh abrasives, sand, shot or dry bead blasting, polishing pastes and the like is prohibited and shall not be used without prior agreement.

[REQ-83]

If grinding is essential on VQC 1 systems, the grinding wheel shall be free of organic components and shall have been manufactured in an oil-free, clean environment.

The material and manufacturing process of the grinding wheel shall be accepted by the IO before use.

12.1.3 Machining requirements

[REQ-84]

Care shall be taken in manufacturing processes so as not to introduce contaminants into surfaces which may be difficult to remove later and which might result in degraded vacuum performance.

[REQ-85]

Cutting fluids shall be water soluble, nonhalogenated and phosphorus and sulphur Free. The maximum allowable content of halogens, phosphorus, and sulphur is 200 ppm (each).

Accepted cutting fluids are listed in Appendix 4 of ITER VHB. The use of other cutting fluids requires prior acceptance.

[REQ-86]

The requirements for machining processes defined in the Appendix B Welding Specification shall be applied at each stage of manufacturing.

12.1.4 Marking

[REO-87]

Marking methods shall be selected is accordance with Section 4.2.3 of Appendix B Welding Specification.

[REQ-88]

Optical fibers within the OFF shall have unique making on each fiber's end in order to identify the fibers during the assembly process.

The recommended by IO method of marking is to use the protective splice sleeve (see Figure 11) at the fiber's end. In this method the inner metal tube is extracted from the protective splice sleeve and marked with a sticker and put back in a sleeve. The protective splice sleeve is put in a fusion splicer for baking.



Figure 11 Protective splice sleeve (example, for information only)

12.2 Welding and Non-Destructive Testing

[REO-89]

All vacuum boundaries welds shall be full penetration butt welds.

[REQ-90]

100% of welds shall be subject to NDT inspection.

[REQ-91]

All vacuum boundary welds of category 2 shall be subject to 100% volumetric examination.

[REQ-92]

Radiographic testing shall be used as a reference method for volumetric testing of welds. Application of ultrasound examination shall be subject to IO acceptance if proven, that the reference method is not feasible.

[REO-93]

Penetrant Testing shall be performed on each weld after the first pass.

[REO-94]

Penetrant Testing shall be performed on each weld after completion of welding operations

12.3 Metrology and tolerances

[REO-95]

Unless otherwise specified in the 2D drawings, all the dimensions shall satisfy the tolerance Class "m" of ISO 2768-1 and tolerance Class "k" of ISO 2768-2.

[REQ-96]

For the series components the tolerances for the interface between OFF and VV ports shall be confirmed by IO in order to ensure that maximum 1 mm misalignment and 1 mm gap are preserved for assembly of OFF onto the VV.

13 Factory Acceptance Test

[REQ-97]

All OFF shall be inspected after the manufacturing to ensure the quality of the final component.

|REO-98|

All welded joints shall pass the Non Destructive Examination in accordance with Appendix B Welding Specification.

[REO-99]

All brazed joints shall pass the Non Destructive Examination in accordance with Appendix C Brazing Specification.

[REQ-100]

All OFF shall be leak tested after the manufacturing according to the Appendix 12 of ITER VHB. The OFF shall be subjected to three thermal cycles from 20°C to 240°C prior to the leak test. Feedthroughs interspace shall be pumped up to pressure of 10⁻³ Pa.

[REQ-101]

The pull test of optical fibers shall be performed after the OFF assembly.

[REO-102]

The dimensional inspection shall be performed at the final acceptance stage.

14 Safety Requirements

14.1 General Safety Requirements

ITER is a Nuclear Facility identified in France by the number-INB-174 ("Installation Nucléaire de Base").

For Protection Important Components and in particular Safety Important Class components (SIC), the French Nuclear Regulation must be observed, in application of the Article 14 of the ITER Agreement.

In such case the Suppliers and Subcontractors must be informed that:

- The Order 7th February 2012 applies to all the components important for the protection (PIC) and the activities important for the protection (PIA).
- The compliance with the INB-order must be demonstrated in the chain of external contractors.
- In application of article II.2.5.4 of the Order 7th February 2012, contracted activities for supervision purposes are also subject to a supervision done by the Nuclear Operator.

The Contractor also shall be familiar with <u>ITER D 43UJN7 - ITER Policy on Safety</u>, <u>Security and Environment Protection Management</u> [AD24]. The ITER Policy on Safety, Security and Environment Protection Management" presents the strategical objectives of ITER Organization in order to comply with the requirements of the Order 7th February 2012.

[REQ-103]

For the Protection Important Components, structures and systems of the nuclear facility, and Protection Important Activities the contractor shall ensure that a specific management system is implemented for his own activities and for the activities done by any Supplier and Subcontractor following the requirements of the Order 7th February 2012 ITER D 7M2YKF - Order dated 7 February 2012 relating to the general technical regulations applicable to INB - EN.

The PICs require control and guaranty of the quality of the PICs during the design and manufacturing phase to ensure its safety functions can be maintained in all postulated situations. This is accomplished through the guidelines provided for in the Propagation of the Defined Requirements for Protection Important Components through the Chain of External Interveners ITER_D_BG2GYB - Propagation of the Defined Requirements for Protection Important Components Through the Chain of External Interveners.

[REO-104]

The Contractor shall guaranty that the defined requirements identified for Protection Important Components and activities are properly cascaded down in its chain of external contractors through their own technical specification. When necessary for the Protection Important Activities related to the nuclear safety demonstration and in particular for assessing the results of the studies, the requirements of the Title III of the INB Order Article 3.8 must be taken into account.

[REQ-105]

The Contractor shall grant access rights to the IO and Host regulatory body representatives to its facilities and records and those of its Contractors and Subcontractors for the purposes of surveillance of defined requirements during the design of a PIC as required by the French Order dated 7th February 2012 ITER D 7M2YKF - Order dated 7 February 2012 relating to the general technical regulations applicable to INB - EN. This surveillance shall also include the examination of all protection-important activities and the follow-up and verification of all corrective actions which are to be implemented according to ITER D 27ECGM - Surveillance Plan for PBS17-OI [AD23].

[REQ-106]

For each PIA performed by the Contractor or one of its sub-contractor (disregarding the level in the supply chain), it shall be demonstrated that:

- The PIA is performed in accordance with procedure and using means for meeting a priori the related defined requirement.
- The PIA is traced to check a posteriori whether the defined requirement were met.

14.2 Protection Important Activities (PIAs)

The list of Protection Important Activities (PIAs) identified for the OFF at different stages of the life cycle is shown in the Table 1.

Each PIA undergoes technical monitoring, to ensure that:

- the activity is carried out in compliance with the requirements defined for the activity and, if necessary, for the PIC concerned;
- appropriate corrective and preventive actions have been defined and implemented.

Table 9 List of Protection Important Activities

Item	PIA	Defined Requirement	
PIA-003	Change tracking and configuration management	Application of the related procedures of ITER quality management system	
PIA-04	Management Of nonconformities, remedial actions, preventive and corrective actions	Application of the related procedures of ITER quality management system	
PIA-05	Propagation of the defined requirements in the contracts	Application of the procedure (BG2GYB)	
PIA-06	Writing of specifications for contracts which include PIC	Compliance with French regulation and Defined requirements for PBS 17-OI (XX7B6U)	
PIA-07	Writing of documents related to PIA's	Compliance with French regulation and Defined requirements for PBS 17-OI (XX7B6U)	
PIA-08	Design and development of PIC components	Check compliance with the Preliminary Safety Report	
		Check compliance with the defined requirements for 17.OI	
		Check application of independent monitoring and controls of studies	
		Check applicable Codes and standards	
PIA-09	Detailed construction design and manufacturing drawings	Check compliance with the defined requirements of PIC's.	
		Check compliance with the technical specifications.	

		Check compliance with the manufacturing and surveillance plans
PIA-10	Manufacturing and Inspection	(MIP) Identification and propagation of PIA in MIP
		Check compliance with the defined requirements of PIC's
		Check compliance with the technical specifications
		Check compliance with MIP Materials procurement
		Welding Witness
PIA-11	Factory Acceptance Tests (FAT)	Compliance of FAT plan of PIC components and acceptance criteria with the technical requirements
PIA-12	Qualification of PIC	The test shall allow to assess if the PIC meets its defined requirements (INB order 7/02/2012 art. 2.5.1)
PIA-13	Preservation of PIC component during temporary storage	Conservation of the PIC capacity to fulfil its Defined requirements. At the Contractors premises
PIA-14	Transportation of PIC, after	Identification and propagation of PIA
	successful completion of factory acceptance tests and shipping to the	Identification and propagation of PIA in MIP/ITP
	ITER Site	Conservation of the PIC capacity during transportation to fulfil its Defined requirements.
PIA-15	Reception of PIC for handover to the ITER Organization at the ITER Site	The test shall allow to assess if the PIC meets its defined requirements

14.3 Propagation of the Defined Requirements

The Contractor will be provided with the initial list of the Defined Requirements associated with the OFF. IO will provide the list as part of the input data for propagation of the defined requirements.

[REQ-107]

The Contractor shall propagate the initial Defined Requirements into the technical requirements according to the procedure Interveners.

[REQ-108]

The Contractor and its external contractors shall include the approved previous level list of Defined Requirements in their technical specifications for the next sublevels in the contractor chain. Any list of Defined Requirements shall be reviewed by IO SRO.

[REQ-109]

The Contractor shall convert the initial defined requirements into technical requirements in order to make them appropriate for the OFF design development, qualification, manufacturing, testing and delivery.

[REQ-110]

The translation of the defined requirements into the technical requirements shall be established through the Detailed Defined Requirements Document. The Contractor shall prepare the Detailed Defined Requirements Document and submit for IO acceptance. The Detailed Defined Requirements Document may be issued in the form of compliance matrix.

14.4 Requirements for the competences and qualifications of the personnel

The requirements in terms of competences and qualifications must be implemented by the external interveners in order to satisfy the requirements of article 2.5.5 of the INB Order:

"The protection-important activities, their technical control, the monitoring and assessment actions must be carried out by persons with the appropriate competences and qualifications."

[REQ-111]

The Contractor implement the requirements for the competences and qualification of the personnel according to the procedure ITER_D_SBT3UA - Generic Requirements for the Competences and Qualifications of External Interveners

[REQ-112]

The contractor is responsible for the implementation of requirements mentioned in this section and shall ensure that its own contractors implement similar provisions.

[REQ-113]

The Contractor shall prepare and submit for IO acceptance the List of the Applicable Documents. The List shall be prepared on the basis of the Reference Documents listed in this technical specification, RPrS, MQP system.

[REQ-114]

The Contractor shall prepare and submit for IO acceptance the "List of documents to be known for each job position/workstation". A given person shall be aware of the contents of these documents. Acquaintance of these documents shall be formalized. The acquaintance for the new versions of the applicable documents shall be updated.

[REQ-115]

The Contractor shall prepare and submit for IO acceptance the "Abilities mastering document". This document shall define:

- Abilities for each position and/or workstation (e.g. education, training, experience, accreditation)
- The number of people needed and level in each of the abilities
- Level of acquaintance for each field of abilities. These levels shall show the capacity of the people to work autonomously or nor, for instance "beginner", "autonomous", "referent" etc.

[REQ-116]

The Contractor shall prepare and submit for IO acceptance the "Names/abilities matching matrix". The Contractor shall provide a nominative matrix that shall show, for the contract, each employee's abilities and levels as above mentioned. This matrix shall demonstrate the adequacy between the abilities of the employees and the abilities required by the various workstation/position.

15 Delivery

15.1 Handling

[REQ-117]

After final cleaning, the handling of the OFF shall be controlled to preserve cleanliness.

[REQ-118]

The suitability of any given area used for handling of the OFF shall be assessed on a regular basis by monitoring the airborne particulate count and shall not exceed 5.0×10^6 particles of size $> 0.5 \mu m$ per m³.

[REQ-119]

The provisions shall be applied in the handling area in accordance with the cleanliness requirements:

- Segregated clean area.
- Limited Access to authorised personnel.
- Authorised equipment operated to approved procedures.
- Management of equipment (e.g. no vacuum pumps exhausting into clean area).
- Daily cleaning of area including floors and surfaces.
- Sticky mats at area entry.
- Daily air quality checks. Results stored in component document package.
- Weekly cleanliness test of area with results stored in component document package.

[REQ-120]

The personnel working in the handling area shall be trained and follow the provisions:

- Protective hair nets.
- Powder free latex or nitrile outer gloves.
- Clean white overalls.
- Overshoes.
- Clean job specific footwear.

[REQ-121]

After the final cleaning powder free latex or nitrile gloves (over cotton or linen if desirable) shall always be used when handling components. Coloured gloves are not acceptable.

15.2 Packing

[REO-122]

Packing conditions and materials shall be defined in a packing procedure. This procedure shall be subjected to the IO's approval.

[REQ-123]

The supplier shall design and supply appropriate packaging, adequate to prevent damage during shipping, lifting and handling operations.

[REO-124]

All components shall be shipped dry internally and externally.

[REO-125]

To prevent damage and possible contamination during transit, the packaging of components shall be done as soon as possible after acceptance testing and final cleaning at the supplier's premises. Cleaning and packaging operations may be witnessed by ITER.

[REQ-126]

Vacuum components shall be handled as little as possible after final cleaning. All subsequent operations shall be carried out in clean conditions (as required in Section 13.1).

The interspace volumes which have been pumped for leak testing shall be backfilled with dry nitrogen or air (<4000 ppm H2O) at a positive pressure of 0.12 MPa and valved off.

All sealing surfaces shall be protected against damage using compatible covers.

```
[REO-129]
```

Each OFF assembly shall be packed in its own rigid packing case or container. In the packing case, all components shall be cushioned and blocked to prevent movement and any physical damage to the component or wrapping material during transport.

The packing shall protect the OFF from thermal and mechanical stresses (particularly shock loads resulting from dropping and mal-handling) which may adversely affect the operation of the OFF.

Each packing shall be provided with shock indicators.

```
[REO-132]
```

The Contractor shall provide detailed procedure subjected to the IO's approval for unpacking. The procedure shall describe how the OFF must be removed from the packing safely and without damage.

```
[REQ-133]
```

The Contractor shall provide the Preservation Procedures to define the process for management and implementation of preservation requirements according to the ITER_D_WRCKZB - WI for Preservation Activities during Storage, Construction and On site before turnover and ITER_D_XT2VTE - Template for Equipment Preservation Procedure.

15.3 Labelling of packing case

```
[REQ-134]
```

Each OFF packing case shall be clearly marked in a permanent way and in a visible place.

All such marking shall be in English and French.

A detailed component identification system together with printed label templates will be provided by the IO.

```
[REQ-135]
```

Handling instructions shall be clearly marked on the outer walls of the packing case.

```
[REQ-136]
```

The mark on the packing case shall allow each component to be uniquely identified.

Components labels shall include as minimum:

- 1) Title of components
- 2) Components numbering system tags Manufacturing Part Numbers, ITER Part Numbers, Serial Numbers.
- 3) Components Classification, e.g. PIC/SIC, QC, VQC, etc.
- 4) Handling instructions.
- 5) Chemical or radiological hazards (if any).

15.4 Delivery Readiness Review

Each OFF and associated components are, tested, cleaned, labelled, packed, protected and received on-site ready for installation.

The Delivery Readiness Review (DRR) is a Hold Point to ensure that the components can be released for shipment.

The purpose of the DRR:

- To perform the final check and the verification of components, packages and corresponding documentation before they leave the Sending Entity and transport to the IO;
- To validate that the IO has all mandatory documentation, customs documents, and/or any other technical or logistical information that is needed so that the material can be adequately managed through transportation, reception, storage, and ultimately into ITER construction and assembly.

DRR mandatory documents:

- Contractor Release Note (CRN)
- Delivery Report
- Packing List (PL)
- Equipment Storage and Preservation Form
- Shipping Plan of Load (SPL) with a specific transportation quality plan containing special requirements for the lifting, handling, etc. to be prepared by the Logistics Service Provider.

The DRR shall follow the procedure <u>ITER_D_X3NEGB</u> - Working Instruction for the Delivery Readiness Review (DRR) .

15.5 Shipment

[REQ-137]

The Contractor shall ensure that the transport organization, and the transport company are insured for damage and/or loss of the components.

16 Final Acceptance

Upon receipt of the package, the IO will open the package and make a visual inspection of its content to check:

- The integrity of the package, including identifying visible damage;
- The number and type of components contained in the shipment;
- The enclosed documentation:
- The reading of the shock indicators;
- The integrity of the components.

IO may perform additional leak test to verify the leak tightness of the components.

The decision on the acceptance of the delivery will be made by IO based on the results of this inspection.

If the components are in an acceptable condition, the IO will sign the Delivery Report.

17 Deliverables and due dates

T0: the date of the contract signed by both parties.

Deliverable		Due date
D # 1	Quality Plan	Kick-off meeting
D# 2	Detailed Work Schedule	Kick-off meeting
Phase I: Man	ufacturing design development	
D# 3	Design Plan for CAD activities	T0 + 32
D# 4	Manufacturing drawings	T0 + 32
D# 5	3D CAD Detailed Models	T0 + 32
D# 6	List of parts	T0 + 32
D # 7	Materials specification	T0 + 32
D# 8 (prelin	Description of the manufacturing processes ninary MIP)	T0 + 32
D# 9	Maintenance and Inspection Plan	T0 + 32
D# 10	Manufacturing Design Report	T0 + 32
Phase II: Qua	alification of the manufacturing processes	
D# 11 Appen	Preliminary Welding Data Package (see dix B for exhaustive list of the documents)	T0 + 36
D# 12 exhaus	Welding Data Package (see Appendix B for stive list of the documents)	T0 + 36
D# 13 Appen	Non-destructive Examination procedures (see dix B for exhaustive list of the documents)	T0 + 36
D# 14 Appen	Preliminary Brazing Data Package (see dix C for exhaustive list of the documents)	T0 + 36
D# 15	Brazing Procedure Qualification Record	T0 + 36
D# 16	Brazing Procedure Approval Record	T0 + 36
D# 17	Final Report	T0 + 36
D# 18 exhaus	Brazing Data Package (see Appendix C for stive list of the documents)	T0 + 36
Phase III: En	vironmental qualification	
D# 19 qualifi	Design report of the full-scale prototype for cation	T0 + 40
D# 20	Manufacturing drawings of the full-scale ype for qualification	T0 + 40
D# 21	Equipment Identification file	T0 + 40
D# 22	Qualification Test Procedures	T0 + 40
D# 23	Qualification Tests Reports	T0 + 40
D# 24	Qualification Synthesis Report	T0 + 40
D# 25	Qualification Preservation Sheet	T0 + 40
Phase IV: Ma	anufacturing Readiness Review	
D# 26	Manufacturing and Inspection Plan	T0 + 42
D# 27	Manufacturing Specification	T0 + 42
D# 28	Materials specifications	T0 + 42
D# 29	Purchase specification for optical fibers	T0 + 42

D# 30	Clean Work Plan	T0 + 42		
D# 31	Cleanliness Preservation Plan	T0 + 42		
D# 32	Leak Test Plan	T0 + 42		
D# 33	Factory Acceptance Test Plan	T0 + 42		
D# 34	General Assembly Drawings	T0 + 42		
Phase V: Ma	nufacturing			
D# 35	Materials certificates	T0 + 48		
D# 36 Apper	Final Welding Documentation (as defined in adix B Welding Specification)	T0 + 48		
D# 37 Apper	Final Brazing Documentation (as defined in adix C Brazing Specification)	T0 + 48		
D# 38	Certificate of conformance for optical fibers	T0 + 48		
D# 39	Certificates of conformance for materials used	T0 + 48		
D# 40 Plan a	Certificates of conformance with Clean Work and manufacturing specifications	T0 + 48		
D# 41	Certificates of conformance with cleanliness ements	T0 + 48		
D# 42 proces	Packing Plan (including unpacking dures)	T0 + 48		
D# 43	Preservation Procedures	T0 + 48		
Phase VI: Fa	actory Acceptance Test			
D# 44	Factory Acceptance Test Reports	T0 + 52		
Phase VII: D	Pelivery			
D# 45	Contractor Release Note (CRN)	T0 + 56		
D# 46	Delivery Report	T0 + 56		
D# 47	Packing List (PL)	T0 + 56		
D# 48	Equipment Storage and Preservation Form	T0 + 56		
D# 49	Shipping Plan of Load (SPL)	T0 + 56		
D# 50	Delivery of the OFF assemblies to IO site	T0 + 56		
Safety Documentation				
D# 51	Detailed list of Protection Important Activities	All phases		
D# 52	Detailed Defined Requirements Document	All phases		
D# 53	List of applicable documents	All phases		
D# 54 position	List of documents to be known for each job on/workstation	All phases		
D# 55	Abilities mastering document	All phases		
D# 56	Names/abilities matching matrix	All phases		

18 Contract follow-up

18.1 Control Points

To ensure a close oversight of the entire activities foreseen in the present technical specification, a system of Control Points will be implemented by the IO in order to keep track of the work advance in accordance with the approved Manufacturing and Inspection Plans (MIP).

The control points shall be integrated into the agreed schedule and defined as the following:

- A **Notification Point (NP)** is a milestone where the Contractor is required to notify the IO that it has completed a specific task or a specific deliverable and is proceeding to the next task or to the next action on the specific deliverable. A NP is meant to enable the IO personnel to follow the progress of the Contract and possibly to witness a critical manufacturing step at the Contractor's premises. The Notification shall be sent by the Contractor to the IO at least 10 working days prior to the scheduled manufacturing step. The IO shall decide whether or not they want to attend. A NP shall not affect the production flow of the Contractor that shall continue the work even without a reply from the IO.
- A Hold Point (HP) and a Sub Hold Points (Sub-HP) is a milestone where the Contractor is required to notify the IO, that it has completed a specific task or a specific deliverable and must stop the associated processes until a HP Clearance is issued. The HP Clearance shall be issued on the basis of clearly identified Quality Control and data and Acceptance test results to be provided to the IO at the time of the request. The IO shall have a maximum of 5 working days to review the Contractors data and to notify the Contractor of its decision. In case of clearance the Contractor shall resume its activity. In case of rejection, the Contractor shall develop a recovery plan that shall be submitted and reviewed by the IO within 10 working days of submission.
- A Witness Point (WP) is a milestone which identifies an operation to be witnessed. Adequate notice shall be given to the IO, in order to allow the IO to participate to the operation.

18.2 Hold Points

Control Point	Deliverables			
1. HP 1 - Phase I: Manufacturing Design Development D#3 – D#10				
2. HP 2 - Phase	II: Qualification of the manufacturing processes			
Sub-HP-2.1	Qualification of welding	D#11 – D#13		
Sub-HP-2.2	Qualification of brazing	D#14 – D#18		
3. HP 3 – Phase	III: Environnemental qualification			
Sub-HP-3.1	Full-scale prototype design development	D#19 – D#20		
Sub-HP-3.2	Environmental qualification and test of the full-scale prototype	D#21 – D#25		
4. HP 4 – Phase IV: Manufacturing Readiness Review				
Sub-HP-4.1 MRR documentation and MRR meeting		D#26 – D#34		
5. HP 5 – Phase V: Manufacturing D#35 – D#43				
6. HP 6 – Phase VI: Factory Acceptance Test D#44				
7. HP 7 – Phase VII: Delivery D#45 – D#50				

18.3 Work monitoring

18.3.1 Data management

The documents generated during the execution of this contract, which the Contractor and its Suppliers shall submit to IO (e.g. technical and QA documents, Minutes of Meetings, ...) will be handled electronically in the ITER Document Management System (IDM).

18.3.2 Monitoring and Access Rights

Planned and documented audits may be performed by the IO to verify the compliance with the technical and quality assurance requirements of the Contract.

[REQ-138]

The IO representatives shall be authorized to access the Contractor's documentation, premises and personnel to carry out surveillance, audit and follow-up activities.

[REQ-139]

These activities may be extended to the Contractor's Subcontractors. The contractor shall therefore ensure that IO's right to conduct periodic audits, reviews, surveillance and inspection of the quality system and verification of its compliance with all quality and technical requirements of the Contract, is incorporated into any subcontract.

[REQ-140]

The Contractor shall grant access rights to the IO and French nuclear regulatory authorities representatives to its facilities and records and those of its suppliers and subcontractors for the purposes of surveillance of defined requirements during the design, construction/manufacturing, commission, assembly, maintenance and surveillance of a PIC. This surveillance also includes the examination of all PIA and the follow-up and verification of all corrective actions which are to be implemented.

18.3.3 Periodic meetings

[REQ-141]

The Contract shall start with an official Kick-Off Meeting where the following items (as a minimum) shall be discussed and agreed:

- Confirmation of the specifications, specific requirements and contractual input.
- The Contractor's Quality Plan.
- The Detailed Work Schedule of the contractual activities, including milestones.
- The Contract Risk Register.

[REO-142]

Progress meetings shall be conducted throughout the whole duration of the Contract at a minimum frequency of one per calendar month. The meetings shall be held by video conference or in-person at the IO's premises or at the Contractor's premises.

[REO-143]

The Minutes of Meeting (MoM) shall be prepared by the Contractor and submitted to the IO no later than one week after the meeting.

1834 Reviews

The IO and the Contractor may organise Status Reviews (SRs), Quality Control Reviews (QCRs) and Safety Review. These may be focused on particular areas of production and will be organised by IO as required by the progress and performance.

[REQ-144]

The contractor shall organize the Manufacturing Readiness Review (MRR) and Delivery Readiness Review (DRR).

19 Quality Assurance requirements

The Contractor conducting the presented activities shall have an ITER approved QA Program or an ISO 9001 accredited quality system. The general requirements are detailed in ITER Procurement Quality Requirements.

Prior to commencement of the task, a Quality Plan must be submitted for IO approval giving evidence of the above and describing the organization for this task; the skill of workers involved in the study; any anticipated sub-contractors; and giving details of who will be the independent checker of the activities (see Procurement Requirements for Producing a Quality Plan ITER D 22MFMW - Requirements for Producing a Quality Plan).

Prior to commencement of any manufacturing, a Manufacturing Inspection Plan must be approved by ITER who will mark up any planned interventions.

Deviations and Nonconformities shall follow the procedure detailed in Procedure for the management of Deviation Request ITER_D_2LZJHB - Procedure for the management of Deviation Request and Procedure for management of Nonconformities ITER_D_22F53X - Procedure for management of Nonconformities.

Prior to delivery of any manufactured items to the IO Site, a Release Note shall be signed in accordance with ITER requirements regarding Contractors Release Notes ITER_D_22F52F - Requirements for Producing a Contractors Release Note.

Documentation developed as the result of the tasks here included shall be retained by the performer of the task for a minimum of 5 years and then may be discarded at the direction of the IO.

20 IO Applicable and Referenced Documents

The following IO documents shall be applied under the scope of this Technical Specification. The last approved version shall be considered as applicable.

```
[AD1] ITER D 2SX3KV - Appendix A Component Drawings - Optical Fiber Feedthrough
[AD2] ITER D 2VEGGR - Appendix B Welding Specification for Optical Fiber Feedthrough
[AD3] ITER D 2Z82VZ - Appendix C Brazing Specification for Optical Fiber Feedthrough
[AD4] ITER D 2Z86YG - Appendix D Optical Fiber Feedthroughs Identification
[AD5] ITER D 2EZ9UM - ITER Vacuum Handbook
[AD6] ITER D 2EL9Y6 - Appendix 2 Environmental Cleanliness
[AD7] ITER D 27Y4QC - Appendix 3 Materials
[AD8] ITER D 2ELN8N - Appendix 4 Accepted Fluids
[AD9] ITER D 2ETNLM - Appendix 10 Vacuum Cables
[AD10]
             ITER D 2EYZ5F - Appendix 12 Leak Testing
            ITER D 2ELUQH - Appendix 13 Cleaning and Cleanliness
[AD11]
            ITER D 22F52F - Requirements for Producing a Contractors Release Note
[AD12]
            ITER D 28QDBS - ITER Numbering System for Components and Parts
[AD13]
            ITER D XX7B6U - Defined requirements for PBS17-OI
[AD14]
            ITER D 22MFG4 - ITER Procurement Quality Requirements
[AD15]
[AD16]
            ITER D SBT3UA - Generic Requirements for the Competences and
      Qualifications of External Interveners
[AD17]
             ITER D 22MFMW - Requirements for Producing a Quality Plan
[AD18]
             ITER D 2LZJHB - Procedure for the management of Deviation Request
```

- [AD19] ITER D 22F53X Procedure for management of Nonconformities
- [AD20] <u>ITER_D_BG2GYB Propagation of the Defined Requirements for Protection</u> <u>Important Components Through the Chain of External Interveners</u>
- [AD21] https://www.swagelok.com/downloads/webcatalogs/EN/MS-01-24.PDF
- [AD22] <u>ITER_D_SBSTBM Provisions for Implementation of the Generic Safety</u>
 Requirements by the External Actors/Interveners
- [AD23] ITER D 27ECGM Surveillance Plan for PBS17-OI
- [AD24] <u>ITER_D_43UJN7 ITER Policy on Safety, Security and Environment Protection</u>
 <u>Management</u>

20.1 Referenced Documents

- [RD1] ITER D TMZPJ6 WP2 Manufacture drawings and documentation
- [RD2] ITER D VVL82R WP3 Qualification test report
- [RD3] ITER D TLLFHC Copper Antiseize coating specification for Invessel components
- [RD4] ITER D XT2VTE Template for Equipment Preservation Procedure
- [RD5] <u>ITER_D_WRCKZB WI for Preservation Activities during Storage, Construction and</u> On site before turnover
- [RD6] ITER D YSQJVE Qualification Plan for 17.OI Optical Fiber Feedthrough
- [RD7] ITER D X3AUHZ IO Template of Qualification Synthesis Report
- [RD8] ITER D WGFF3G Qualification guidelines
- [RD9] ITER D 2F6FTX Procedure for the Usage of the ITER CAD Manual
- [RD10] ITER D 2DWU2M Procedure for the CAD management plan
- [RD11] <u>ITER_D_P7Q3J7 Specification for CAD data Production in ITER direct</u> contracts
- [RD12] ITER D 249WUL CAD Manual 07 CAD Fact Sheet
- [RD13] <u>ITER_D_395MKE DCIF for the contract for Procurement of Optical Fibre Feedthrough</u>
- [RD14] ITER D 44SZYP Working Instruction for Manufacturing Readiness Review
- [RD15] <u>ITER_D_X3NEGB Working Instruction for the Delivery Readiness Review</u> (DRR)